



**RECALL OF CERTAIN
TITAN/CONSHELF DIN HANDWHEEL RETAINERS**

Aqua Lung was recently informed about the breakage, under pressure, of a TITAN/CONSHELF DIN HANDWHEEL RETAINER weakened during service by manual torque loads superior to the recommended values.

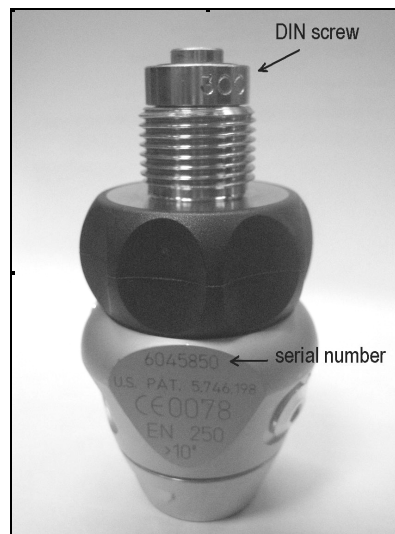

Aqua Lung asks all the owners of TITAN DIN regulators whose serial number is lower than 6062501 or TITAN/CONSHELF DIN adaptors that are marked 300 BAR MAX to return their regulator to their Aqua Lung authorized retailer for an upgrade.

The corrective action is replacement of the brass DIN HANDWHEEL RETAINER by another stainless steel DIN HANDWHEEL RETAINER marked 300 BAR MAXI.

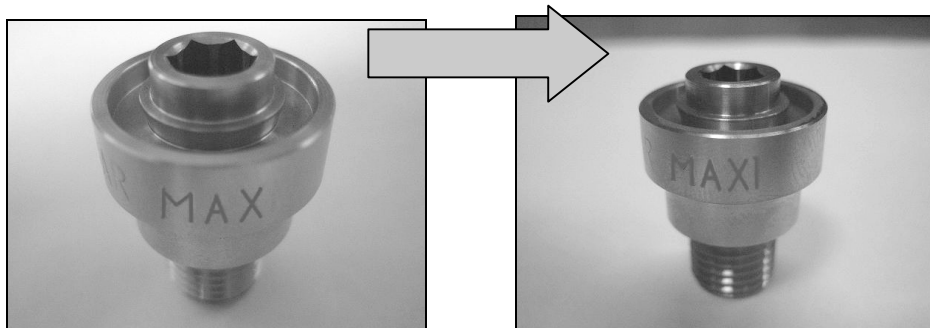

This replacement is made under warranty.

All the TITAN DIN regulators whose serial number are above 6062501 and/or whose DIN handwheel retainer is marked 300 BAR MAXI are assembled with a stainless steel DIN handwheel retainer and are not affected by this recall.